

## Case 300 : Narrative

Case Vehicle (A): 2001 Buick
Type: LeSabre Custom, 4-door sedan
Driver: 61-year-old female
CDC: 99-0000-0, 12-FDEW-1, 12-FREE-4, 00-TYDO-3

### SITUATION

[1](#) [2](#) On a cloudy night, case vehicle (A) was traveling north in a rural area, in the left northbound lane of a 4-lane divided limited-access highway. The road surface was dry, it was dark and unlighted, the speed limit was 70 mph (113 kph), and the female driver reportedly had the cruise control set to the speed limit. A deer entered the roadway in front of case vehicle (A), and the vehicle struck the deer with its front end. [3](#) [4](#) After the impact with the deer, the driver lost control of the vehicle, and case vehicle (A) crossed the right northbound lane and exited the east edge of the roadway. [5](#) [6](#) [7](#) Case vehicle (A) continued to travel at a high speed down a slight ditch and through thick brush and small trees located 39 meters north of where it exited the road. [8](#) [9](#) [10](#) [11](#) It continued to travel north up an embankment and struck a 35-cm diameter tree with its right-front corner. The tree was located 35-meters east of the road edge and 134 meters north of where the vehicle exited the roadway. [12](#) The right-front wheel snagged on the tree causing the vehicle to rotate clockwise approximately 90 degrees until it tripped on the left-side wheels and rolled three quarter turns, before it came to rest on its right side facing southeast. [13](#) [14](#) The bumper cover separated from the vehicle and was found near the tree. This vehicle is equipped with OnStar, which immediately contacted emergency personnel, who asked the driver if she was conscious. The driver responded and stayed in communication with OnStar personnel until the police arrived at the scene. The driver was transported to a local hospital with police reported "B" injuries, and the vehicle was towed from the scene.

## GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

Case vehicle (A) was involved in four separate impact events. [15](#) In the first impact, the front of the vehicle struck a deer, resulting in damage that was masked by a subsequent impact with the tree. [16](#) In the second impact, the front contacted the thick brush and multiple small trees, resulting in minor scratches across the entire front end. [17](#) In the third event, the right-front corner of case vehicle (A) struck the 35-cm diameter tree. The damage from this impact began at the right-front corner and extended 35-cm across the front, resulting in 21-percent vehicle overlap. The maximum rearward crush was 34 cm measured at the right-front corner. The damage from this impact also extended 90-cm rearward along the right fender. [18](#) The fourth event was a rollover involving three quarter turns. The maximum crush from contact with the ground during the rollover was 13 cm to the roof area. [19](#) The direct damage from the rollover extended along the entire right side, and also included the left side, roof, and hood.

Using the WinSMASH crash-reconstruction program and c-values measured for case vehicle (A), the following impact severity was calculated for the frontal impact with the large tree. However, the confidence in this estimate is low due to the narrowness of the direct damage.

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	27 (17)	-27 (-17)	0 (0)

## DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

### Exterior

[20](#) [15](#) The front bumper was damaged and the bumper cover was completely separated from the vehicle. The grille was damaged, and both headlight assemblies were broken. [21](#)

The hood was crushed and pushed rearward and to the right, and the hood latch was damaged and jammed. [22](#) [23](#) [24](#) [25](#) Both hood hinges were deformed, but not separated, allowing the rear edge of the hood to elevate and move rearward, and to contact and crack the right-lower corner of the windshield. There were also cracks throughout the right and center portions of the windshield due to roof deformation that occurred during the rollover. [27](#) [28](#) On the right side, the front fender was crushed into the wheel well, the right-front wheel and axle were damaged and the tire was completely separated from the wheel, and the right wheelbase was increased 6 cm. [29](#) [30](#) The right-front door was damaged and the exterior shell was ripped from the door frame. [31](#) The right-front door was also jammed closed, the door-window glass was broken, and the window frame was bent down. [32](#) The upper and lower portions of the right A-pillar and the upper portion of the right B-pillar were deformed, and [26](#) the right side of the roof was crushed down. There was no damage to the right-rear door and the door was operational. [33](#) Also, there was no damage to the rear quarter panel, and the right-rear wheel was not damaged, but there was dirt embedded into the hubcap. There was no other damage to the right side.

[34](#) [35](#) On the left side, direct damage from the rollover was primarily to the left fender but there was minor damage that extended along the entire left side into both doors and the rear quarter panel. [36](#) There was no damage to the left A-, B-, or C-pillars, and both doors were operational, but the [37](#) left-front and left-rear wheels were damaged and the wheelbase was extended 9 cm. [19](#) Also, the left-roof siderail and roof were deformed downward. There was no other damage to the left side of case vehicle (A).

[38](#) There was no damage to the rear of case vehicle (A).

## **Interior**

[39](#) [40](#) [41](#) This vehicle is equipped with steering-wheel and passenger frontal-impact airbags, which deployed, probably during the impact with the large tree. There were black marks on the upper-right portion of the driver airbag, possibly from driver facial makeup. [42](#) [43](#) There was no damage to the steering-wheel rim or hub, and no rotation of the steering column. [44](#) The upper, mid, and lower portions of the instrument panel were damaged, and

the vent outlets and heater ducts were deformed. [45](#) [46](#) The knee bolster panel was contacted by the driver and became separated from its mounting brackets. [52](#) There was no deformation to the floor in the driver area, and there was no damage to the brake or accelerator pedals. [49](#) The roof siderail, roof structure, and roof headlining in the driver area were deformed and displaced downward. [47](#) [48](#) There was no damage to the center console, but the glove compartment was damaged and the door was open. [50](#) The left and right sunvisors and the windshield top molding were damaged from the rollover impact. [51](#) In the right-front seat area, the windshield top molding, the right A- and B-pillars, and the roof structure and headlining were damaged. [53](#) The kickpanel and sill in the right front were damaged and displaced to the left. [54](#) [55](#) [56](#) [57](#) The following intrusions were noted and measured:

Location	Component	Distance (cm)	Direction
driver	roof	9	down
	roof siderail	5	down
right front	door	21	to left
	sill	20	to left
	kickpanel	14	to left
	roof	13	down
	roof siderail	10	down
	A-pillar	2	to left

## OCCUPANT KINEMATICS AND INJURIES

[58](#) The 5-ft, 5-in, 190-lb, 61-year-old female driver was wearing the seat-integrated three-point belt, and the steering-wheel airbag deployed. [60](#) [61](#) Plastic transfer marks on the shoulder-belt webbing indicate belt use at the time of the crash, but there were no visible marks on the plastic shoulder belt guides at the top of the seatback. [59](#) This vehicle is also equipped with a side-impact airbag, which did not deploy.



During the multiple frontal impact events, the driver moved forward into the belt restraints and airbag. [62](#) She sustained an abrasion to the nose and forehead from contact by the deploying airbag. She sustained contusions across the left and right breasts from loading by the shoulder belt, and a contusion across the lower abdomen from loading by the lap belt. [63](#) She sustained contusions to the anterior portions of the left and right arms above the elbows, probably from contact by the airbag or possibly from contact with the steering wheel. [64](#) She also sustained contusions to the left and right knees from contact with the knee bolster, as indicated by damage to the bolster and the fact that the bolster was separated from its mountings. [65](#) She sustained contusions to the upper portions of the left and right ankles, probably from contact with the foot controls, or possibly with components located under the instrument panel during the rollover.

The following table [66](#) and attached drawing summarizes the injuries for the restrained driver.

Occupant: Driver	Age: 61 years	Gender: Female		
Restraints: 3-point belt worn; steering-wheel airbag deployed side-impact airbag did <i>not</i> deploy	Stature: 165 cm (5 ft, 5 in)	Mass: 86 kg (190 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Abrasion, forehead	1	Airbag	—	—
Abrasion, nose	1	Airbag	—	—
Contusions, across left and right breasts	1	Shoulder belt	—	—
Contusion, across lower abdomen	1	Lap belt	—	—
Contusions, anterior left arm above the elbow	1	—	Airbag	Steering wheel
Contusions, anterior right arm above the elbow	1	—	Airbag	Steering wheel
Contusion, left knee	1	Knee bolster	—	—
Contusion, right knee	1	Knee bolster	—	—
Contusion, upper portion of left ankle	1	—	Foot controls	Area beneath instrument panel
Contusion, upper portion of right ankle	1	—	Foot controls	Area beneath instrument panel
Maximum A.I.S. Severity	1	—	—	—
Injury Severity Score	1	—	—	—

CASE NO.: 2004-01

CASE VEHICLE: 2001 Buick


TYPE: Left-side busway, 4-door sedan

OCCUPANT: Driver's 35-year-old female

STATURE: 165 cm (5 ft 5 in) - MAJOR: 68 kg (150 lb)

RESTRAINTS: 5-point seat belt, always-reclined  
(side impact airbag did not deploy)

SEVERITY: MAJOR - 1 MINOR - 1



**Figure 1**

Figure 1. The effect of the number of trials on the number of correct responses.

[illegible]


**Abstract**

**Figure 1**

[illegible]

100

1000



# Vehicle Report

## General

## Conditions

Variable Number and Name	Code Value	Code Description	Other Options
V206 — Urban/Rural Area	2	Rural	<a href="#">more</a>
V207 — Limited Access Highway	1	Yes	<a href="#">more</a>
V208 — Road Total Lanes	5	Divided, 4 lanes or more	<a href="#">more</a>
V209 — Intersecting Road Total Lanes	8	Not applicable	<a href="#">more</a>
V210 — Road Surface Type	1	Asphalt	<a href="#">more</a>
V211 — Road Defects	0	No	<a href="#">more</a>
V212 — Construction Zone	0	No	<a href="#">more</a>
V213 — Road Alignment Vertical Plane	1	Level	<a href="#">more</a>
V214 — Road Alignment Horizontal Plane	1	Straight	<a href="#">more</a>
V215 — Surface Covering	10	Dry	<a href="#">more</a>
V216 — Visibility Limitation	0	None	<a href="#">more</a>
V217 — Visibility Obstruction	0	None	<a href="#">more</a>
V218 — Speed Limit	8	106+ km/h .. 65+ mph	<a href="#">more</a>
V219 — Precipitation Type	0	None	<a href="#">more</a>
V220 — Precipitation Rate	8	Not applicable	<a href="#">more</a>
V221 — Temperature	9	Unknown	<a href="#">more</a>
V222 — Crosswind	9	Unknown	<a href="#">more</a>
V223 — Light Conditions	5	Dark, unlighted	<a href="#">more</a>
V224 — Mechanical Malfunction Mention	0	No	<a href="#">more</a>
V225 — Case Vehicle and Object	1	Yes	<a href="#">more</a>
V226 — Case Vehicle Rollover	2	Yes, Subsequent Event	<a href="#">more</a>

V227 — Case Vehicle Ran Off Roadway	0	No	<a href="#">more</a>
V228 — Moving Case Vehicle/Contacted Moving Vehicle	0	No	<a href="#">more</a>
V229 — Case Vehicle/Contacted Stopped Vehicle	0	No	<a href="#">more</a>
V230 — Stopped Case Vehicle/Contactd Vehicle	0	No	<a href="#">more</a>
V231 — Total Vehicles Hit By Case Vehicle	0	0 vehicles	<a href="#">more</a>
V232 — Any Fire in Crash	0	No	<a href="#">more</a>
V233 — Max Police Severity-PAR	2	B - Non-Incapacitating Injury	<a href="#">more</a>
V234 — Driver Alcohol Involvement	0	Had not been drinking	<a href="#">more</a>
V235 — Driver Alcohol BAC	80	Not tested	<a href="#">more</a>
V236 — Driver Impairment Mention	0	No	<a href="#">more</a>
V237 — Driven/Towed From Scene	2	Towed Due to Damage	<a href="#">more</a>

## Other Vehicle

Variable Number and Name	Code Value	Code Description	Other Options
V301 — Other Vehicle VIN			<a href="#">more</a>
V303 — Other Vehicle Manufacturer	998	No Other Vehicle	<a href="#">more</a>
V304 — Other Vehicle Body Code	98	No Other Vehicle	<a href="#">more</a>
V305 — Other Vehicle Make/Model	0000	No other vehicle	<a href="#">more</a>
V306 — Other Vehicle Model Year	9999	No other vehicle	<a href="#">more</a>
V307 — Other Vehicle Mass	999998	No other vehicle	<a href="#">more</a>
V308 — Other Vehicle Number	8	No other vehicle	<a href="#">more</a>
V309 — Other Vehicle Number of Occupants	98	No other vehicle	<a href="#">more</a>
V310 — Other Vehicle Traveling Speed	999	Unknown	<a href="#">more</a>
V311 — Highest Police Injury Severity	8	Unoccupied Vehicle	<a href="#">more</a>
V312 — Other Vehicle Type	98	No Other Vehicle	<a href="#">more</a>
V313 — Other Vehicle Wheelbase (cm)	998	No other vehicle	<a href="#">more</a>
V314 — Average Track Width	999	Unknown	<a href="#">more</a>
V315 — Overall Length	999	Unknown	<a href="#">more</a>
V316 — Overall Width (OAW)	999	Unknown	<a href="#">more</a>
V317 — Front Overhang (FOH)	999	Unknown	<a href="#">more</a>
V318 — Rear Overhang (ROH)	999	Unknown	<a href="#">more</a>
V319 — Undeformed End Width (UEW)	999	Unknown	<a href="#">more</a>
V320 — Engine Displacement	9.9 l	—	—
V321 — Engine: Number of Cylinders	99	Unknown	<a href="#">more</a>
V322 — Direct Damage Length (DDL)	999	Unknown	<a href="#">more</a>
V323 — Front-End Overlap % (FEO)	99	Missing or Not applicable	<a href="#">more</a>
V324 — Vehicle Overlap % (VOL)	99	Missing or Not applicable	<a href="#">more</a>

## Case Vehicle

### General

Variable Number and Name	Code Value	Code Description	Other Options
V401 — VIN	1G4HP54KX1U1	—	—
V402 — Manufacturer/Body Code	11128	—	—
V403 — Vehicle Manufacturer	111	Buick	<a href="#">more</a>
V404 — Vehicle Body Code	28	—	—
V405 — Make/Model Code	0441	Le Sabre	<a href="#">more</a>
V406 — Model Year	2001	—	—
V407 — Vehicle Mass	001528 kg	—	—
V408 — Odometer Reading	888888	—	—
V409 — Number of Occupants	01	—	—
V410 — Traveling Speed	113 kph	—	—
V411 — Body Type	14	4-door sedan	<a href="#">more</a>
V412 — Stolen Vehicle	8	Not currently collected	<a href="#">more</a>
V413 — Body Structure	2	Unitized	<a href="#">more</a>
V414 — Transmission Type	1	Automatic	<a href="#">more</a>
V415 — Transmission Lever Location	3	Column	<a href="#">more</a>
V416 — Steering	1	Power	<a href="#">more</a>
V417 — Brakes	1	Power	<a href="#">more</a>
V418 — Brake Type	2	Disc - front wheels	<a href="#">more</a>
V419 — Brake Anti-lock Device	2	Four-wheel	<a href="#">more</a>
V420 — Air Conditioning in Vehicle	8	Not currently collected	<a href="#">more</a>
V421 — Drive Type	2	Front wheel	<a href="#">more</a>
V422 — Dual Rear Wheels	0	No	<a href="#">more</a>
V423 — Original Restraint System Type	3	Airbag	<a href="#">more</a>



V424 — Equipped With Roll Bar	0	No	<a href="#">more</a>
V425 — Roof Type	1	Solid	<a href="#">more</a>
V426 — Wheelbase	277 cm	—	—
V427 — Anti-lacerative Glass	0	None	<a href="#">more</a>
V428 — Average Track Width	157 cm	—	—
V429 — Overall Length	495 cm	—	—
V430 — Overall Width (OAW)	185 cm	—	—
V431 — Front Overhang	106 cm	—	—
V432 — Rear Overhang	112 cm	—	—
V433 — Undeformed End Width (UEW)	170 cm	—	—
V434 — Engine Displacement	3.8 <i>l</i>	—	—
V435 — Engine: Number of Cylinders	06	—	—
V436 — Direct Damage Length (DDL)	035 cm	—	—
V437 — Front End Overlap % (FEO)	21	—	—
V438 — Vehicle Overlap % (VOL)	23	—	—

## Case Vehicle

## Damage

## Description

Variable Number and Name	Code Value	Code Description	Other Options
V501 — Maximum Crush - Front	034 cm	—	—
V502 — Maximum Crush - Right Side	039 cm	—	—
V503 — Maximum Crush - Rear	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V504 — Maximum Crush - Left Side	019 cm	—	—
V505 — Maximum Crush - Roof	013 cm	—	—
V506 — Maximum Crush - Other	999	Unknown	<a href="#">more</a>
V507 — Are Events In Chronological Order	1	Yes	<a href="#">more</a>
V508 — Event 1 Impact Location	4	Outside Roadside right-of-way	<a href="#">more</a>
V509 — Event 1 Impact Configuration	17	FRONT of case veh - object	<a href="#">more</a>
V510 — Event 1 Object/Vehicle Contacted	73	Large animal	<a href="#">more</a>
V511 — Event 2 Impact Location	4	Outside Roadside right-of-way	<a href="#">more</a>
V512 — Event 2 Impact Configuration	17	FRONT of case veh - object	<a href="#">more</a>
V513 — Event 2 Object/Vehicle Contacted	85	Small post/tree, rural mailbox, delineator	<a href="#">more</a>
V514 — Event 3 Impact Location	4	Outside Roadside right-of-way	<a href="#">more</a>
V515 — Event 3 Impact Configuration	17	FRONT of case veh - object	<a href="#">more</a>
V516 — Event 3 Object/Vehicle Contacted	77	Sign post, utility pole, tree	<a href="#">more</a>
V517 — Event 4 Impact Location	4	Outside Roadside right-of-way	<a href="#">more</a>
V518 — Event 4 Impact Configuration	61	Case vehicle rollover - less than 360 degrees	<a href="#">more</a>
V519 — Event 4 Object/Vehicle Contacted	80	Ground (rollover only)	<a href="#">more</a>
V520 — Event 5 Impact Location	8	No 5th event	<a href="#">more</a>
V521 — Event 5 Impact Configuration	88	No 5th event	<a href="#">more</a>

V522 — Event 5 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V523 — Event 6 Impact Location	8	No 6th event	<a href="#">more</a>
V524 — Event 6 Impact Configuration	88	No 6th event	<a href="#">more</a>
V525 — Event 6 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V526 — Event 7 Impact On Road	8	No 7th event	<a href="#">more</a>
V527 — Event 7 Impact Configuration	88	No 7th event	<a href="#">more</a>
V528 — Event 7 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V529 — Primary CDC Case Vehicle -event Number	3	Event 3	<a href="#">more</a>
V530 — Primary CDC Case Vehicle - impact speed	999	Unknown	<a href="#">more</a>
V531 — Primary CDC Case Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V532 — Primary CDC Case Vehicle -crush	034	—	—
V533 — Primary CDC Case Vehicle -clock #1	12	12 o'clock	<a href="#">more</a>
V534 — Primary CDC Case Vehicle letter 1 #1	06	F - Front	<a href="#">more</a>
V535 — Primary CDC Case Vehicle letter 2 #1	18	R - Right (Front or Rear)	<a href="#">more</a>
V536 — Primary CDC Case Vehicle letter 3 #1	05	E - Everything below belt line	<a href="#">more</a>
V537 — Primary CDC Case Vehicle letter 4 #1	05	E - Corner (extends from corner to = or < 16 in [410mm])	<a href="#">more</a>
V538 — Primary CDC Case Vehicle Extent #1	04	Extent 4	<a href="#">more</a>
V539 — Primary CDC Case Vehicle -CDC #1	12FREE4	—	—
V541 — Primary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V542 — Primary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V543 — Primary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V544 — Primary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V545 — Primary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V546 — Primary CDC Case Vehicle -CDC #2	9800000	—	—
V547 — Primary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	<a href="#">more</a>
V548 — Primary CDC Contacted Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V549 — Primary CDC Contacted Vehicle -crush	998	Not Applicable	<a href="#">more</a>

V550 — Primary CDC Contacted Vehicle -clock #1	98	Not Applicable	<a href="#">more</a>
V551 — Primary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V552 — Primary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V553 — Primary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V554 — Primary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V555 — Primary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	<a href="#">more</a>
V556 — Primary CDC Contacted Vehicle -CDC #1	9800000	—	—
V558 — Primary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V559 — Primary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V560 — Primary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V561 — Primary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V562 — Primary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V563 — Primary CDC Contacted Vehicle -CDC #2	9800000	—	—
V564 — Secondary CDC Case Vehicle - Event No	4	Event 4	<a href="#">more</a>
V565 — Secondary CDC Case Vehicle - Impact Speed	999	Unknown	<a href="#">more</a>
V566 — Secondary CDC Case Vehicle - Estimated By	1	—	—
V567 — Secondary CDC Case Vehicle -crush	013	—	—
V568 — Secondary CDC Case Vehicle -clock #1	00	Nonhorizontal force	<a href="#">more</a>
V569 — Secondary CDC Case Vehicle letter 1 #1	20	T - Top	<a href="#">more</a>
V570 — Secondary CDC Case Vehicle letter 2 #1	25	Y - Side or end (F + P or L + C)	<a href="#">more</a>
V571 — Secondary CDC Case Vehicle letter 3 #1	04	D - Distributed	<a href="#">more</a>
V572 — Secondary CDC Case Vehicle letter 4 #1	15	O - Rollover (includes rolling onto side)	<a href="#">more</a>
V573 — Secondary CDC Case Vehicle Extent #1	03	Extent 3	<a href="#">more</a>
V574 — Secondary CDC Case Vehicle -CDC #1	00TYDO3	—	—
V576 — Secondary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V577 — Secondary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V578 — Secondary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V579 — Secondary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>

V580 — Secondary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V581 — Secondary CDC Case Vehicle -CDC #2	9800000	—	—
V582 — Secondary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	<a href="#">more</a>
V583 — Secondary CDC Contacted Vehicle - Estimated By	1	—	—
V584 — Secondary CDC Contacted Vehicle -crush	998	Not Applicable	<a href="#">more</a>
V585 — Secondary CDC Contacted Vehicle -clock #1	98	Not Applicable	<a href="#">more</a>
V586 — Secondary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V587 — Secondary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V588 — Secondary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V589 — Secondary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V590 — Secondary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	<a href="#">more</a>
V591 — Secondary CDC Contacted Vehicle -CDC #1	9800000	—	—
V593 — Secondary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V594 — Secondary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V595 — Secondary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V596 — Secondary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V597 — Secondary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V598 — Secondary CDC Contacted Vehicle -CDC #2	9800000	—	—

## Crash Severity

Variable Number and Name	Code Value	Code Description	Other Options
V601 — Case Vehicle Primary Impact Number	1	—	—
V602 — Primary Impact Total Delta-V	027 kph	—	—
V603 — Primary Case Vehicle Reconstructed Longitudinal Delta-V	-027 kph	—	—
V604 — Primary Case Vehicle Reconstructed Lateral Delta-V	0000 kph	—	—
V605 — Primary Case Vehicle Reconstructed Crush Energy	0559 kJ	—	—
V606 — Primary Impact Case Vehicle - reconstruction	21	Reconstructed, low confidence level	<a href="#">more</a>
V607 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	<a href="#">more</a>
V608 — Primary Contacted Vehicle Reconstructed Total Delta-V	888	N/A	<a href="#">more</a>
V609 — Primary Contacted Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V610 — Primary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V611 — Primary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V612 — Case Vehicle Secondary Impact Number	8	—	—
V613 — Secondary Case Vehicle Reconstructed Total Delta-V	888	N/A	<a href="#">more</a>
V614 — Secondary Case Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V615 — Secondary Case Vehicle Reconstructed Lateral Delta-V	8888	—	—
V616 — Secondary Case Vehicle Reconstructed Crush Energy	8888	—	—
V617 — Secondary Case Vehicle Reconstruction Note	88	—	—
V618 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	<a href="#">more</a>
V619 — Secondary Contacted Vehicle	888	N/A	<a href="#">more</a>

Reconstructed Total Delta-V			
V620 — Secondary Contacted Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V621 — Secondary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V622 — Secondary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V623 — Case Vehicle Primary Impact Number	1	—	—
V624 — Primary Case Vehicle Reconstructed Total EBS	027 kph	—	—
V625 — Primary Case Vehicle Reconstructed Longitudinal EBS	-027 kph	—	—
V626 — Primary Case Vehicle Reconstructed Lateral EBS	0000 kph	—	—
V627 — Primary Case Vehicle Reconstructed Crush Energy	0559 kJ	—	—
V628 — Primary Case Vehicle Reconstruction Note	21	Reconstructed, low confidence level	<a href="#">more</a>
V629 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	<a href="#">more</a>
V630 — Primary Contacted Vehicle Reconstruction Total EBS	888	N/A	<a href="#">more</a>
V631 — Primary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V632 — Primary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V633 — Primary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V634 — Case Vehicle Secondary Impact Number	8	Not applicable	<a href="#">more</a>
V635 — Secondary Case Vehicle Reconstruction Total EBS	888	N/A	<a href="#">more</a>
V636 — Secondary Case Vehicle Reconstruction Longitudinal EBS	8888	—	—
V637 — Secondary Case Vehicle Reconstruction Lateral EBS	8888	—	—
V638 — Secondary Case Vehicle Reconstruction Crush Energy	8888	—	—
V639 — Secondary Case Vehicle Reconstruction Note	88	—	—

V640 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	<a href="#">more</a>
V641 — Secondary Contacted Vehicle Reconstruction Total EBS	888	N/A	<a href="#">more</a>
V642 — Secondary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V643 — Secondary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V644 — Secondary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V645 — Case Vehicle Reconstructed Impact Number	1	—	—
V646 — Case Vehicle Impact 1 Plane	1	Bumper	<a href="#">more</a>
V647 — Case Vehicle Impact 1 Direct Damage Length [DDL]	035 cm	—	—
V648 — Case Vehicle Impact 1 Max Crush	034 cm	—	—
V649 — Case Vehicle Impact 1 Field-L	170 cm	—	—
V650 — Case Vehicle Impact 1 C1	000 cm	No Crush	<a href="#">more</a>
V651 — Case Vehicle Impact 1 C2	000 cm	No Crush	<a href="#">more</a>
V652 — Case Vehicle Impact 1 C3	000 cm	No Crush	<a href="#">more</a>
V653 — Case Vehicle Impact 1 C4	000 cm	No Crush	<a href="#">more</a>
V654 — Case Vehicle Impact 1 C5	000 cm	No Crush	<a href="#">more</a>
V655 — Case Vehicle Impact 1 C6	034 cm	—	—
V656 — Case Vehicle Impact 1 +/- D	0067 cm	—	—
V657 — Case Vehicle Reconstructed Impact Number	2	—	—
V658 — Case Vehicle Impact 2 Plane	9	Unknown	<a href="#">more</a>
V659 — Case Vehicle Impact 2 Direct Damage Length [DDL]	999	Unknown	<a href="#">more</a>
V660 — Case Vehicle Impact 2 Max Crush	999	Unknown	<a href="#">more</a>
V661 — Case Vehicle Impact 2 Field-L	999	Unknown	<a href="#">more</a>
V662 — Case Vehicle Impact 2 C1	999	Unknown	<a href="#">more</a>
V663 — Case Vehicle Impact 2 C2	999	Unknown	<a href="#">more</a>
V664 — Case Vehicle Impact 2 C3	999	Unknown	<a href="#">more</a>



V665 — Case Vehicle Impact 2 C4	999	Unknown	<a href="#">more</a>
V666 — Case Vehicle Impact 2 C5	999	Unknown	<a href="#">more</a>
V667 — Case Vehicle Impact 2 C6	999	Unknown	<a href="#">more</a>
V668 — Case Vehicle Impact 2 +/- D	0999 cm	—	—
V669 — Other Vehicle Reconstructed Impact Number	9	Unknown	<a href="#">more</a>
V670 — Other Vehicle Impact 1 Plane	9	Unknown	<a href="#">more</a>
V671 — Other Vehicle Impact 1 Direct Damage Length [DDL]	999	Unknown	<a href="#">more</a>
V672 — Other Vehicle Impact 1 Max Crush	999	Unknown	<a href="#">more</a>
V673 — Other Vehicle Impact 1 Field-L	999	Unknown	<a href="#">more</a>
V674 — Other Vehicle Impact 1 C1	999	Unknown	<a href="#">more</a>
V675 — Other Vehicle Impact 1 C2	999	Unknown	<a href="#">more</a>
V676 — Other Vehicle Impact 1 C3	999	Unknown	<a href="#">more</a>
V677 — Other Vehicle Impact 1 C4	999	Unknown	<a href="#">more</a>
V678 — Other Vehicle Impact 1 C5	999	Unknown	<a href="#">more</a>
V679 — Other Vehicle Impact 1 C6	999	Unknown	<a href="#">more</a>
V680 — Other Vehicle Impact 1 +/- D	9999	—	—
V681 — Other Vehicle Reconstructed Impact Number	9	Unknown	<a href="#">more</a>
V682 — Other Vehicle Impact 2 Plane	9	Unknown	<a href="#">more</a>
V683 — Other Vehicle Impact 2 Direct Damage Length [DDL]	999	Unknown	<a href="#">more</a>
V684 — Other Vehicle Impact 2 Max Crush	999	Unknown	<a href="#">more</a>
V685 — Other Vehicle Impact 2 Field-L	999	Unknown	<a href="#">more</a>
V686 — Other Vehicle Impact 2 C1	999	Unknown	<a href="#">more</a>
V687 — Other Vehicle Impact 2 C2	999	Unknown	<a href="#">more</a>
V688 — Other Vehicle Impact 2 C3	999	Unknown	<a href="#">more</a>
V689 — Other Vehicle Impact 2 C4	999	Unknown	<a href="#">more</a>
V690 — Other Vehicle Impact 2 C5	999	Unknown	<a href="#">more</a>
V691 — Other Vehicle Impact 2 C6	999	Unknown	<a href="#">more</a>
V692 — Other Vehicle Impact 2 +/- D	9999	—	—

## Case Vehicle

### Tires & Rims

Variable Number and Name	Code Value	Code Description	Other Options
V701 — Left Front Wheel Damaged	1	Yes	<a href="#">more</a>
V702 — Right Front Wheel Damaged	1	Yes	<a href="#">more</a>
V703 — Right Rear Wheel Damaged	0	No	<a href="#">more</a>
V704 — Left Rear Wheel Damaged	1	Yes	<a href="#">more</a>
V705 — Left Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V706 — Right Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V707 — Right Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V708 — Left Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V709 — Left Front Carcass Construction	3	Radial	<a href="#">more</a>
V710 — Right Front Carcass Construction	3	Radial	<a href="#">more</a>
V711 — Right Rear Carcass Construction	3	Radial	<a href="#">more</a>
V712 — Left Rear Carcass Construction	3	Radial	<a href="#">more</a>
V717 — Left Front Tire Size	P22560R16	—	—
V718 — Right Front Tire Size	P22560R16	—	—
V719 — Right Rear Tire Size	P22560R16	—	—
V720 — Left Rear Tire Size	P22560R16	—	—

## Case Vehicle

### Fuel, Tank, Fire

Variable Number and Name	Code Value	Code Description	Other Options
V801 — Propulsive Fuel Type	1	Gasoline	<a href="#">more</a>
V802 — Main Tank Location	322	Within frame/centered laterally - within vertically	<a href="#">more</a>
V803 — Main Filler Cap Location	113	Left of frame laterally - above vertically	<a href="#">more</a>
V804 — Main Tank Material	9	Unknown	<a href="#">more</a>
V805 — Aux Tank Type	8	Not applicable (not equipped)	<a href="#">more</a>
V806 — Aux Tank Location	888	Not applicable (not equipped)	<a href="#">more</a>
V807 — Aux Filler Cap Location	888	Not applicable (not equipped)	<a href="#">more</a>
V808 — Aux Tank Material	8	Not applicable	<a href="#">more</a>
V901 — Fuel Leakage From Crash	0	No	<a href="#">more</a>
V1001 — Fire In Or On Case Vehicle	0	No	<a href="#">more</a>

## Case Vehicle

### Exterior

Variable Number and Name	Code Value	Code Description	Other Options
V1101 — Hood Latch Released	0	No	<a href="#">more</a>
V1102 — Hood Latch Damaged	1	Yes	<a href="#">more</a>
V1103 — Hood Latch Jammed	1	Yes	<a href="#">more</a>
V1104 — Left Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1105 — Left Hood Hinge Separated	0	No	<a href="#">more</a>
V1106 — Right Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1107 — Right Hood Hinge Separated	0	No	<a href="#">more</a>
V1108 — Hood Remained On Vehicle	1	Yes	<a href="#">more</a>
V1109 — Rear Hood Edge Elevated	1	Yes	<a href="#">more</a>
V1110 — Edge Contacted Windshield	1	Yes	<a href="#">more</a>
V1111 — Edge Penetrated Windshield	8	Not applicable	<a href="#">more</a>
V1112 — Hood Latch Location	1	Front of Vehicle	<a href="#">more</a>
V1113 — Eng/Transmissn Mount Separation	0	No	<a href="#">more</a>
V1114 — Steerng Column Flex Coupling	9	Unknown if equipped	<a href="#">more</a>
V1115 — Steerng Column Coupling Damaged	9	Unknown	<a href="#">more</a>
V1116 — Steerng Column Coupling Separated	9	Unknown	<a href="#">more</a>
V1117 — Eng Comp Telescopng Unit	88	Not collected	<a href="#">more</a>
V1118 — Comp Orig/Telescopd Diff	888	Not collected	<a href="#">more</a>
V1119 — Left Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>
V1120 — Upper Left A-pillar Separation	0	No	<a href="#">more</a>
V1121 — Lower Left A-pillar Separation	0	No	<a href="#">more</a>
V1122 — Upper Left B-pillar Separation	0	No	<a href="#">more</a>
V1123 — Lower Left B-pillar Separation	0	No	<a href="#">more</a>
V1124 — Upper Left C-pillar Separation	0	No	<a href="#">more</a>
V1125 — Lower Left C-pillar Separation	0	No	<a href="#">more</a>

V1126 — Upper Left D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1127 — Lower Left D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1128 — Left Front Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1129 — Left Rear Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1130 — Left Front Door Jammed Closed	0	No	<a href="#">more</a>
V1131 — Left Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1132 — Rear Door Type	0	No door (includes pickups)	<a href="#">more</a>
V1133 — Rear Door Opening Cause	8	Not applicable (no rear door)	<a href="#">more</a>
V1134 — Rear Door Jammed Closed	8	Not applicable (no rear door)	<a href="#">more</a>
V1135 — Luggage Partition Damagd	0	No	<a href="#">more</a>
V1136 — Spare Tire Status	8	Not collected	<a href="#">more</a>
V1137 — Trailer Hitch Type	0	No hitch	<a href="#">more</a>
V1138 — Trailer Type	0	No trailer	<a href="#">more</a>
V1139 — Right Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>
V1140 — Upper Right A-pillar Separation	4	No separation, but damaged	<a href="#">more</a>
V1141 — Lower Right A-pillar Separation	4	No separation, but damaged	<a href="#">more</a>
V1142 — Upper Right B-pillar Separation	4	No separation, but damaged	<a href="#">more</a>
V1143 — Lower Right B-pillar Separation	0	No	<a href="#">more</a>
V1144 — Upper Right C-pillar Separation	0	No	<a href="#">more</a>
V1145 — Lower Right C-pillar Separation	0	No	<a href="#">more</a>
V1146 — Upper Right D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1147 — Lower Right D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1148 — Right Front Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1149 — Right Rear Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1150 — Right Front Door Jammed Closed	1	Yes	<a href="#">more</a>
V1151 — Right Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1152 — Van Rear Door Type	8	Not applicable (not a van)	<a href="#">more</a>
V1153 — Windshield Cracked		Yes	<a href="#">more</a>

V1154 — Windshield Broken	0	No	<a href="#">more</a>
V1155 — Windshield Cracked or Broken by Occupant	0	No	<a href="#">more</a>
V1156 — Bond Separation Extent	0	None	<a href="#">more</a>
V1157 — Windshield Code		—	—
V1158 — Did Sun/T Roof Open	8	Not Applicable	<a href="#">more</a>

## Case Vehicle

### Steering

#### Column/Rim

Variable Number and Name	Code Value	Code Description	Other Options
V1201 — Steering Wheel Rim Damage	0	None	<a href="#">more</a>
V1202 — Number of Steering Wheel Spokes	4	4 spokes	<a href="#">more</a>
V1203 — Steering Wheel Spoke Damage	0	None	<a href="#">more</a>
V1204 — Column Tilt Feature	3	Middle	<a href="#">more</a>
V1205 — Column Swing-away Feature	0	Not equipped	<a href="#">more</a>
V1206 — Column Telescoping Feature	0	Not equipped	<a href="#">more</a>
V1207 — Wheel Energy Absorb Device	8	Not collected	<a href="#">more</a>
V1208 — Wheel Ea Orig/Damaged Diff	888	Not collected	<a href="#">more</a>
V1209 — Column Energy Absorb Device	88	Not collected	<a href="#">more</a>
V1210 — Column Ea Orig/Comprss Diff	888	Not collected	<a href="#">more</a>
V1211 — Shear Capsule Separation	888	Not collected	<a href="#">more</a>
V1212 — Column Vertical Rotation	0	No apparent rotation	<a href="#">more</a>
V1213 — Column Lateral Rotation	0	No apparent rotation	<a href="#">more</a>
V1214 — Steering Wheel Hub Damage	0	None	<a href="#">more</a>

## Case Vehicle

### Intrusion

Variable Number and Name	Code Value	Code Description	Other Options
V1301 — Occupant Compartment Intrusion	1	Yes	<a href="#">more</a>
V1302 — Was Intrusion Catastrophic	0	No	<a href="#">more</a>
V1303 — Intrusion Number 01	01	Intrusion #1	<a href="#">more</a>
V1304 — Intrusion 01 Occupant Space Number	11	First row, Left seat	<a href="#">more</a>
V1305 — Intrusion 01 Intruding Object	15	Roof or convertible top	<a href="#">more</a>
V1306 — Intrusion 01 Assoc Event Number	4	Event #4	<a href="#">more</a>
V1307 — Intrusion 01 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1308 — Intrusion 01 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1309 — Intrusion 01 Max Intrusion Z-axis	09 cm	—	—
V1310 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1311 — Intrusion 01 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1312 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1313 — Intrusion 01 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1314 — Intrusion Number 02	02	Intrusion #2	<a href="#">more</a>
V1315 — Intrusion 02 Occupant Space Number	11	First row, Left seat	<a href="#">more</a>
V1316 — Intrusion 02 Intruding Object	14	Roof side rails	<a href="#">more</a>
V1317 — Intrusion 02 Assoc Event Number	4	—	—
V1318 — Intrusion 02 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1319 — Intrusion 02 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1320 — Intrusion 02 Max Intrusion Z-axis	05 cm	—	—
V1321 — Intrusion 02 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1322 — Intrusion 02 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1323 — Intrusion 02 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1324 — Intrusion 02 Injury Number	00	No injury or no intrusion	<a href="#">more</a>



V1325 — Intrusion Number 03	03	Intrusion #3	<a href="#">more</a>
V1326 — Intrusion 03 Occupant Space Number	13	First row, Right seat	<a href="#">more</a>
V1327 — Intrusion 03 Intruding Object	09	Door panel or side panel	<a href="#">more</a>
V1328 — Intrusion 03 Assoc Event Number	3	Event #3	<a href="#">more</a>
V1329 — Intrusion 03 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1330 — Intrusion 03 Max Intrusion Y-axis	21 cm	—	—
V1331 — Intrusion 03 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1332 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1333 — Intrusion 03 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1334 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1335 — Intrusion 03 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1336 — Intrusion Number 04	04	Intrusion #4	<a href="#">more</a>
V1337 — Intrusion 04 Occupant Space Number	13	First row, Right seat	<a href="#">more</a>
V1338 — Intrusion 04 Intruding Object	30	Sill	<a href="#">more</a>
V1339 — Intrusion 04 Assoc Event Number	3	Event #3	<a href="#">more</a>
V1340 — Intrusion 04 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1341 — Intrusion 04 Max Intrusion Y-axis	20 cm	—	—
V1342 — Intrusion 04 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1343 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1344 — Intrusion 04 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1345 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1346 — Intrusion 04 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1347 — Intrusion Number 05	05	Intrusion #5	<a href="#">more</a>
V1348 — Intrusion 05 Occupant Space Number	13	First row, Right seat	<a href="#">more</a>
V1349 — Intrusion 05 Intruding Object	29	Side footwell panel (kickpanel)	<a href="#">more</a>
V1350 — Intrusion 05 Assoc Event Number	3	Event #3	<a href="#">more</a>
V1351 — Intrusion 05 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1352 — Intrusion 05 Max Intrusion Y-axis	14 cm	—	—

V1353 — Intrusion 05 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1354 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1355 — Intrusion 05 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1356 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1357 — Intrusion 05 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1358 — Intrusion Number 06	06	Intrusion #6	<a href="#">more</a>
V1359 — Intrusion 06 Occupant Space Number	13	First row, Right seat	<a href="#">more</a>
V1360 — Intrusion 06 Intruding Object	15	Roof or convertible top	<a href="#">more</a>
V1361 — Intrusion 06 Assoc Event Number	4	—	—
V1362 — Intrusion 06 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1363 — Intrusion 06 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1364 — Intrusion 06 Max Intrusion Z-axis	13 cm	—	—
V1365 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1366 — Intrusion 06 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1367 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1368 — Intrusion 06 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1369 — Intrusion Number 07	07	Intrusion #7	<a href="#">more</a>
V1370 — Intrusion 07 Occupant Space Number	13	First row, Right seat	<a href="#">more</a>
V1371 — Intrusion 07 Intruding Object	14	Roof side rails	<a href="#">more</a>
V1372 — Intrusion 07 Assoc Event Number	4	—	—
V1373 — Intrusion 07 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1374 — Intrusion 07 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1375 — Intrusion 07 Max Intrusion Z-axis	10 cm	—	—
V1376 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1377 — Intrusion 07 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1378 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1379 — Intrusion 07 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1380 — Intrusion Number 08	08	Intrusion #8	<a href="#">more</a>
V1381 — Intrusion 08 Occupant Space	13	First row, Right seat	<a href="#">more</a>

Number			
V1382 — Intrusion 08 Intruding Object	08	A-pillar	<a href="#">more</a>
V1383 — Intrusion 08 Assoc Event Number	3	Event #3	<a href="#">more</a>
V1384 — Intrusion 08 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1385 — Intrusion 08 Max Intrusion Y-axis	02 cm	—	—
V1386 — Intrusion 08 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1387 — Intrusion 08 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1388 — Intrusion 08 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1389 — Intrusion 08 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1390 — Intrusion 08 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1391 — Intrusion Number 09	00	No Intrusion, None	<a href="#">more</a>
V1392 — Intrusion 09 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1393 — Intrusion 09 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1394 — Intrusion 09 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1395 — Intrusion 09 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1396 — Intrusion 09 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1397 — Intrusion 09 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1398 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1399 — Intrusion 09 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1400 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1401 — Intrusion 09 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1402 — Intrusion Number 10	00	No Intrusion, None	<a href="#">more</a>
V1403 — Intrusion 10 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1404 — Intrusion 10 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1405 — Intrusion 10 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1406 — Intrusion 10 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1407 — Intrusion 10 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1408 — Intrusion 10 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>

V1409 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1410 — Intrusion 10 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1411 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1412 — Intrusion 10 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1413 — Door Intrusion Number 01	03	—	—
V1414 — Door Intrusion Number 01 Cause	1	Direct impact	<a href="#">more</a>
V1415 — Door Intrusion Number 02	88	Not Applicable	<a href="#">more</a>
V1416 — Door Intrusion Number 02 Cause	8	Not applicable	<a href="#">more</a>
V1417 — Door Intrusion Number 03	88	Not Applicable	<a href="#">more</a>
V1418 — Door Intrusion Number 03 Cause	8	Not applicable	<a href="#">more</a>
V1419 — Door Intrusion 01 Component	88	Not Applicable	<a href="#">more</a>
V1420 — Door Intrusion 01 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1421 — Door Intrusion 01 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1422 — Door Intrusion 02 Component	88	Not Applicable	<a href="#">more</a>
V1423 — Door Intrusion 02 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1424 — Door Intrusion 02 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1425 — Door Intrusion 03 Component	88	Not Applicable	<a href="#">more</a>
V1426 — Door Intrusion 03 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1427 — Door Intrusion 03 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1428 — Door Intrusion 04 Component	88	Not Applicable	<a href="#">more</a>
V1429 — Door Intrusion 04 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1430 — Door Intrusion 04 Component Damaged 2	8	Not Applicable	<a href="#">more</a>

## Case Vehicle

### Airbag(s)

Variable Number and Name	Code Value	Code Description	Other Options
V1501 — Driver Airbag Equipped	1	Yes	<a href="#">more</a>
V1502 — Driver Airbag Deployed	1	Yes	<a href="#">more</a>
V1503 — Driver Airbag Condition	0	No Damage	<a href="#">more</a>
V1504 — Passenger Airbag Equip	1	Yes	<a href="#">more</a>
V1505 — Passenger Airbag Deployed	1	Yes	<a href="#">more</a>
V1506 — Passenger Airbag Condition	0	No Damage	<a href="#">more</a>
V1507 — Steering Wheel Airbag Tether	1	Yes	<a href="#">more</a>
V1508 — Driver Airbag Marked By Contact	1	Yes	<a href="#">more</a>
V1509 — Passenger Airbag Tether	0	No	<a href="#">more</a>
V1510 — Passenger Airbag Marked By Contact	0	No	<a href="#">more</a>

## Case Vehicle

### Interior

Variable Number and Name	Code Value	Code Description	Other Options
V1601 — Left Front Door Damaged	0	No	<a href="#">more</a>
V1602 — Right Front Door Damaged	1	Yes	<a href="#">more</a>
V1603 — Left Front Hardware Damaged	0	No	<a href="#">more</a>
V1604 — Right Front Hardware Damaged	1	Yes	<a href="#">more</a>
V1605 — Left Front Armrest Damaged	0	No	<a href="#">more</a>
V1606 — Right Front Armrest Damaged	1	Yes	<a href="#">more</a>
V1607 — Left Front Glass Damaged	0	No	<a href="#">more</a>
V1608 — Right Front Glass Damaged	1	Yes	<a href="#">more</a>
V1609 — Left Rear Door Area Damaged	0	No	<a href="#">more</a>
V1610 — Right Rear Door Area Damaged	0	No	<a href="#">more</a>
V1611 — Left Rear Hardware Damaged	0	No	<a href="#">more</a>
V1612 — Right Rear Hardware Damaged	0	No	<a href="#">more</a>
V1613 — Left Rear Armrest Damaged	0	No	<a href="#">more</a>
V1614 — Right Rear Armrest Damaged	0	No	<a href="#">more</a>
V1615 — Left Rear Glass Damaged	0	No	<a href="#">more</a>
V1616 — Right Rear Glass Damaged	0	No	<a href="#">more</a>
V1617 — Left Roof Side Rail Damaged	1	Yes	<a href="#">more</a>
V1618 — Right Roof Side Rail Damaged	1	Yes	<a href="#">more</a>
V1619 — Left B-pillar Damaged	0	No	<a href="#">more</a>
V1620 — Right B-pillar Damaged	1	Yes	<a href="#">more</a>
V1621 — Left C-pillar Damaged	0	No	<a href="#">more</a>
V1622 — Right C-pillar Damaged	0	No	<a href="#">more</a>
V1623 — Left D-pillar Damaged	8	Not applicable	<a href="#">more</a>
V1624 — Right D-pillar Damaged	8	Not applicable	<a href="#">more</a>
V1625 — Left Headlining Damaged	1	Yes	<a href="#">more</a>

V1626 — Right Headlining Damaged	1	Yes	<a href="#">more</a>
V1627 — Left Roof Structure Damaged	1	Yes	<a href="#">more</a>
V1628 — Right Roof Structure Damaged	1	Yes	<a href="#">more</a>
V1629 — Left T/Sun Roof Damaged	8	Not applicable	<a href="#">more</a>
V1630 — Right T/Sun Roof Damaged	8	Not applicable	<a href="#">more</a>
V1631 — Other Left Side Item Damagd	8	Not applicable	<a href="#">more</a>
V1632 — Other Right Side Item Damagd	8	Not applicable	<a href="#">more</a>
V1633 — Foot Controls Damaged	0	No	<a href="#">more</a>
V1634 — Ignition Key Damaged	0	No	<a href="#">more</a>
V1635 — Rear View Mirror Damaged	0	No	<a href="#">more</a>
V1636 — Sunvisor/Fitting Damaged	7	Both sides	<a href="#">more</a>
V1637 — Windshield Molding Damaged	1	Yes	<a href="#">more</a>
V1638 — Left A-pillar Damaged	0	No	<a href="#">more</a>
V1639 — Right A-pillar Damaged	1	Yes	<a href="#">more</a>
V1640 — Center Console Damaged	0	No	<a href="#">more</a>
V1641 — Transmission Lever Damaged	0	No	<a href="#">more</a>
V1642 — Horn/Spoke Shroud Damagd	0	No	<a href="#">more</a>
V1643 — Upper Panel Damaged	1	Yes	<a href="#">more</a>
V1644 — Mid Panel Damaged	1	Yes	<a href="#">more</a>
V1645 — Lower Panel Damaged	1	Yes	<a href="#">more</a>
V1646 — Ashtray Damaged	1	Yes	<a href="#">more</a>
V1647 — Control Knob/Lever Damaged	0	No	<a href="#">more</a>
V1648 — Glove Compartment Area Damaged	1	Yes	<a href="#">more</a>
V1649 — Instruments Damaged	0	No	<a href="#">more</a>
V1650 — Park Brake Release Damaged	0	No	<a href="#">more</a>
V1651 — Park Brake Pedal Damaged	0	No	<a href="#">more</a>
V1652 — A/C Or Upper Vent Damaged	1	Yes	<a href="#">more</a>
V1653 — Heater Or A/C Duct Damaged	1	Yes	<a href="#">more</a>
V1654 — Radio Damaged	0	No	<a href="#">more</a>

V1655 — Other Item Damaged	8	Not applicable	<a href="#">more</a>
V1656 — Rear Window Damaged	0	No	<a href="#">more</a>
V1657 — Rear Window Header Damaged	0	No	<a href="#">more</a>
V1658 — Vertical Console Damaged	8	Not applicable	<a href="#">more</a>
V1659 — Roof Console Damaged	0	No	<a href="#">more</a>



## Case Vehicle


### Seats

Variable Number and Name	Code Value	Code Description	Other Options
V1701 — Driver Front Seat Type	08	Indiv split bench - driver wide	<a href="#">more</a>
V1702 — Passenger Front Seat Type	09	Indiv bench - passenger wide	<a href="#">more</a>
V1703 — Driver Seat Mount Type	1	Standard	<a href="#">more</a>
V1704 — Passenger Seat Mount Type	1	Standard	<a href="#">more</a>
V1705 — Driver Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1706 — Passenger Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1707 — Driver Seat Original Equipment	1	Yes	<a href="#">more</a>
V1708 — Passenger Seat Original Equipment	1	Yes	<a href="#">more</a>
V1709 — Driver Seat/Rear Occupant Contact	8	Not applicable	<a href="#">more</a>
V1710 — Passenger Seat/Rear Occupant Contact	8	Not applicable	<a href="#">more</a>
V1711 — Driver Seat Damage	0	None	<a href="#">more</a>
V1712 — Passenger Seat Damage	2	Cushion only damaged	<a href="#">more</a>
V1713 — Center Front Armrest Damaged	0	No	<a href="#">more</a>
V1714 — Driver Seat Rotation	0	None apparent	<a href="#">more</a>
V1715 — Passenger Seat Rotation	5	Multiple rotations	<a href="#">more</a>
V1716 — Driver Seat-back Type	3	Reclining	<a href="#">more</a>
V1717 — Passenger Seat-back Type	3	Reclining	<a href="#">more</a>
V1718 — Driver Seat-back Lock Type	1	Manual	<a href="#">more</a>
V1719 — Passenger Seat-back Lock Type	1	Manual	<a href="#">more</a>
V1720 — Driver Seat-back Lock Held	1	Yes	<a href="#">more</a>
V1721 — Passenger Seat-back Lock Held	1	Yes	<a href="#">more</a>
V1722 — Driver Recliner Mechanism Held	1	Yes	<a href="#">more</a>

V1723 — Passenger Recliner Mechanism Held	1	Yes	<a href="#">more</a>
V1724 — Driver Head Restraint Type	1	Adjustable	<a href="#">more</a>
V1725 — Passenger Head Restraint Type	1	Adjustable	<a href="#">more</a>
V1726 — Driver Head Rest Removed	0	No	<a href="#">more</a>
V1727 — Passenger Head Rest Removed	0	No	<a href="#">more</a>
V1728 — Driver Head Rest Adjustment	2	Down	<a href="#">more</a>
V1729 — Passenger Head Rest Adjustment	2	Down	<a href="#">more</a>
V1730 — Driver Head Rest Damage	0	None	<a href="#">more</a>
V1731 — Passenger Head Rest Damage	0	None	<a href="#">more</a>
V1732 — Driver Seat Adjustment Type	2	Power	<a href="#">more</a>
V1733 — Passenger Seat Adjustment Type	2	Power	<a href="#">more</a>
V1734 — Driver Seat Adjustment Provided	3	6-way	<a href="#">more</a>
V1735 — Passenger Seat Adjustment Provided	3	6-way	<a href="#">more</a>
V1736 — Driver Seat Adjuster Damage	9	Unknown	<a href="#">more</a>
V1737 — Passenger Seat Adjuster Damage	1	Chucking (free play)	<a href="#">more</a>
V1738 — Driver Seat Adjuster Separation	8	Not applicable	<a href="#">more</a>
V1739 — Passenger Seat Adjuster Separation	0	None	<a href="#">more</a>
V1740 — Driver Seat Pre-crash Position	9	Unknown	<a href="#">more</a>
V1741 — Passenger Seat Pre-crash Position	9	Unknown	<a href="#">more</a>
V1742 — Left Rear Seat Type	1	Non-folding	<a href="#">more</a>
V1743 — Right Rear Seat Type	1	Non-folding	<a href="#">more</a>
V1744 — Left Rear Seat Damaged	0	None	<a href="#">more</a>
V1745 — Right Rear Seat Damaged	0	None	<a href="#">more</a>
V1746 — Center Rear Armrest Damaged	8	Not applicable (No Center Armrest)	<a href="#">more</a>
V1747 — Left Rear Seat-back Left Lock Equipped	8	Not applicable	<a href="#">more</a>

V1748 — Right Rear Seat-back Left Lock Equipped	8	Not applicable	<a href="#">more</a>
V1749 — Left Rear Seat-back Left Lock Held	8	Not applicable	<a href="#">more</a>
V1750 — Right Rear Seat-back Left Lock Held	8	Not applicable	<a href="#">more</a>
V1751 — Left Rear Seat-back Right Lock Equipped	8	Not applicable	<a href="#">more</a>
V1752 — Right Rear Seat-back Right Lock Equipped	8	Not applicable	<a href="#">more</a>
V1753 — Left Rear Seat-back Right Lock Held	8	Not applicable	<a href="#">more</a>
V1754 — Right Rear Seat-back Right Lock Held	8	Not applicable	<a href="#">more</a>
V1755 — Left 3rd Seat Equipped	0	No	<a href="#">more</a>
V1756 — Right 3rd Seat Equipped	0	No	<a href="#">more</a>
V1757 — Left 3rd Seat Backrest Damaged	8	Not applicable	<a href="#">more</a>
V1758 — Right 3rd Seat Backrest Damaged	8	Not applicable	<a href="#">more</a>
V1759 — Left 3rd Seat Cushion Damaged	8	Not applicable	<a href="#">more</a>
V1760 — Right 3rd Seat Cushion Damaged	8	Not applicable	<a href="#">more</a>
V1761 — Rear Head Restraints	0	Not Equipped (or removed)	<a href="#">more</a>

# MEASUREMENTS IN CENTIMETERS

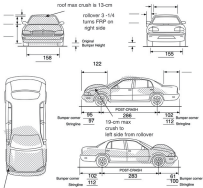


Impact #3 to right-front corner and down right side (34-cm max, 20-cm direct damage)

Impact #1: from deer unknown damage  
Impact #2: from brush, small trees (170-cm direct damage across front, max crush minor)  
Impact #4: rolover (max crush 13-cm to roof)


## WINDSHIELD MARK ON CASE VEHICLE:

? KURIT  
?? - GOBAIN  
SOLAR RAY  
SAFETY FLO-LITE  
LAMINATED  
/ M53VV  
0 ...


ROLLOVER  
ROOF DAMAGE



HOOD EDGE CONTACT



seat-integrated belt: crease in  
webbing



A: knee bolster  
(same off)

Circle ending

ANSWER: 44, 24, 24, 10, 10



Circle ending (front)



Circle ending (side)  
Circle ending (back)

Circle ending (side)  
Circle ending (back)

Circle ending (side)  
Circle ending (back)



Passenger Airbag



Circle 1 

If yes, how many: \_\_\_\_\_

Circle 1 

If yes, how many: \_\_\_\_\_

Passenger Airbag Mount

Single Row



Bag comes out of both

# Case # 300: Occupant # 1; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	06	Face	<a href="#">more</a>
V2105 — Primary OIC -aspect	19	Superior/upper	<a href="#">more</a>
V2106 — Primary OIC -lesion	01	Abrasion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	FSAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 300: Occupant # 1; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	06	Face	<a href="#">more</a>
V2105 — Primary OIC -aspect	03	Central	<a href="#">more</a>
V2106 — Primary OIC -lesion	01	Abrasion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	FCAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 300: Occupant # 1; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	03	Chest	<a href="#">more</a>
V2105 — Primary OIC -aspect	23	Whole region	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	CWCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 300: Occupant # 1; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	13	Abdomen	<a href="#">more</a>
V2105 — Primary OIC -aspect	23	Whole region	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	MWCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 300: Occupant # 1; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	65	Steering wheel	<a href="#">more</a>
V2104 — Primary OIC -body Region	01	Arm (upper)	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	ALCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 300: Occupant # 1; Injury # 6

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	06	Injury #6	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	65	Steering wheel	<a href="#">more</a>
V2104 — Primary OIC -body Region	01	Arm (upper)	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	ARCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 300: Occupant # 1; Injury # 7

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	07	Injury #7	<a href="#">more</a>
V2102 — 1st Prob Contact Area	48	Knee restraint	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	11	Knee	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	KLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—



# Case # 300: Occupant # 1; Injury # 8

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	08	Injury #8	<a href="#">more</a>
V2102 — 1st Prob Contact Area	48	Knee restraint	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	11	Knee	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	KRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 300: Occupant # 1; Injury # 9

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	09	Injury #9	<a href="#">more</a>
V2102 — 1st Prob Contact Area	28	Foot controls (including parking brake pedal)	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	57	Beneath instrument panel	<a href="#">more</a>
V2104 — Primary OIC -body Region	17	Ankle/foot	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	QLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 300: Occupant # 1; Injury #10

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	10	Injury #10	<a href="#">more</a>
V2102 — 1st Prob Contact Area	28	Foot controls (including parking brake pedal)	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	57	Beneath instrument panel	<a href="#">more</a>
V2104 — Primary OIC -body Region	17	Ankle/foot	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	QRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 300: Occupant # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	01	Occupant #1	<a href="#">more</a>
V2002 — Occupant Role At 1st Impact	1	Motor vehicle driver	<a href="#">more</a>
V2003 — Occupant Position -row	1	1st row	<a href="#">more</a>
V2004 — Occupant Position -lateral	1	Left	<a href="#">more</a>
V2005 — Occupant Position -posture	10	Sitting on seat	<a href="#">more</a>
V2006 — Occupant Age In Years	61	—	—
V2007 — Occupant Age In Months	25	25 months or older	<a href="#">more</a>
V2008 — Occupant Mass	085 kg	—	—
V2009 — Occupant Height	165 cm	—	—
V2010 — Occupant Sex	2	Female	<a href="#">more</a>
V2011 — Occupant Treatment/Mortality	02	Treated at hospital/clinic but not admitted	<a href="#">more</a>
V2012 — Injury Severity Score	01	ISS 1	<a href="#">more</a>
V2013 — Non-impact Med Condition	0	None	<a href="#">more</a>
V2014 — Police Injury Severity	2	B - Non-incapacitating Injury	<a href="#">more</a>
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2016 — Active Restraint Usage	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2017 — Passive Restraint System	1	Air bag installed	<a href="#">more</a>
V2018 — Passive Restraint Usage	2	Air bag deployed	<a href="#">more</a>
V2019 — Child Seat Type	88	Not applicable (adult or older child)	<a href="#">more</a>
V2020 — Occupant Ejection Degree	0	None	<a href="#">more</a>
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	<a href="#">more</a>

V2022 — Highest OIC Severity	1	Minor	<a href="#">more</a>
V2023 — Head Restraint Available	1	Equipped	<a href="#">more</a>
V2024 — Occupant Eyewear	1	Glasses	<a href="#">more</a>
V2025 — Source of Occupant Info	7	Combination of above	<a href="#">more</a>



































































RINKER

IMP 3527  
6-441C  
IMP 15622

IMP 2538











118572  
6 MAR  
VIN 13422  
XK1











118572  
6MAS  
VIN 134222  
XKYP  
11-5-01





















118572 INTI  
PT

LA SABRE

10230  
4601  
MSD













V230

RINKER

118572 INT  
FT



118572 INTI  
PT

LA SABRE





















































































